

Date: 28.09.2020

To

The Principal

Sri Chaitanya Techno School

Site No. 131/2, Pooja Garden

1st Main, 8th Cross, Ashirwad Colony

Horamavu, Bangalore-43

Sir,

Sub: Issue of Advice on requirement of Fire Prevention,
Fire Fighting & Evacuation measures of
Sri Chaitanya Techno School
Site No. 131/2, Pooja Garden
1st Main, 8th Cross, Ashirwad Colony
Horamavu, Bangalore-43

Ref-1: Your Letter dated

2: Report No.20/RFO/BNG-EAST/NOC 2015 Dated 07.09.2020

The Regional Fire Officer, Bangalore East Range, Bangalore had from fire Prevention, and Fire fighting and evacuation point of view, inspected the premises of **Sri Chaitanya Techno School, Site No. 131/2, Pooja Garden, 1st Main, 8th Cross, Ashirwad Colony, Horamavu, Bangalore-48** on 01.09.2020 for suggesting fire prevention, fire fighting and evacuation measure. The details are as follows:

Details of the Building:

1. Address of the Premises : Sri Chaitanya Techno School
Site No. 131/2, Pooja Garden
1st Main, 8th Cross, Ashirwad Colony
Horamavu, Bangalore-48

2. Number of Building : One Building

3. Number of Floors : Ground Floor & 3 Upper Floors

4. Floor Wise details of Occupancy :

Ground Floor : Principal Room, Store Room, Admin Room, Staff Room and
8 Class Rooms

1st Floor : One Sports Room, Physics Lab, Chemistry Lab, Biology Lab,
Library room, AV Room, 6 Class Room

Satyajog M. R
Principal
Sri Chaitanya Techno School
Horamavu

- 2nd Floor : One Computer Lab, 12 Class Room
 3rd Floor : 11 Classrooms
5. Height of the building : 13.70 Mtrs
 6. Site Area : 85,445 Sq.mtrs
7. Built up area of Each floor :
- Ground Floor : 10,000 Sq mtrs
 1st Floor : 10,000 Sq mtrs
 2nd Floor : 10,000 Sq mtrs
 3rd Floor : 10,000 Sq mtrs
8. Type of Construction : RCC Building
 9. Surrounding Properties :
- East : Residential Building
 West : Vacant Land
 North : Residential Building
 South : Residential Building
10. Name and Address of the Building Owner : M/s Nexgen Educational Trust,
 Sri Chaitanya Techno School,
 Site No. 131/2, Pooja Garden
 1st Main, 8th Cross, Ashirwad Colony
 Horamavu, Bangalore-43
11. Address of Applicant : The Principal,
 Sri Chaitanya Techno School,
 Site No. 131/2, Pooja Garden
 1st Main, 8th Cross, Ashirwad Colony
 Horamavu, Bangalore-43
12. Number of the Students : Students : 582
 Staff : 42

B. On inspection of the school premises, the following fire protection, firefighting and evacuation measures are recommended and they are absolutely essential.

Detail (1)	Existing (2)	Recommendations (3)
---------------	-----------------	------------------------

- | | | |
|-----------------------------|---|----------------------------------|
| 1. Approach to the Premises | The Premises is accessible from 06.00Mts wide road with which is located on eastern | The requirement is Compiled with |
|-----------------------------|---|----------------------------------|

Shylpa M.R
Principal
 Sri Chaitanya Techno School
 Horamavu


Side and is connected to 12.00mts wide
Horamavu main road

2. Number of Staircases	2 Staircases, each of 1.50mts width in each block have been provided	The requirement is complied with
3. Portable Fire Extinguishers	09 Nos ABC fire in addition to the existing Extinguishing each of 4kgs extinguishers 06 Nos ABC fire capacity & one Co Extinguisher shall be provided. Extinguisher of 2 kg have been provided	The requirement is complied with
4. Fire Prevention Measures	Not indicated	1. Explosive and Inflammable Materials should not be stored in the premises. 2. Accumulation of combustible in and around the premises should be avoided. 3. The Doors shall not be kept locked/latched during working hours and shall be free from obstructions
5. Escape Routes	Marked on the each floor visibly to guide the students / Staff make safer places.	The requirement is complied with
6. First Aid Box	One First Aid Box have been provided in each floor	The requirement is complied with
7. Safe Assembly Area	The marked safe assemble on the Northern side has been earmarked for safe Assembly area.	The requirement is complied with
8. Fire Order	Displayed	The requirements is complied with
9. Fire Fighting Training	Not Trained	Atleast 40% of the Should be got trained in Fire prevention and the Fire fighting evacuation Measures at R.A.Mundkur Fire & Emergency services Academy, B G Road, Bengaluru-29

Shrilya.M.R
Principal
Sri Chaitanya Techno School
Sri Chaitanya Horamavu School
Horamavu

Under the circumstances stated above there is No Objection to run Education Activities in your School building subject to the condition of providing additional firefighting equipment and fire precautionary measures shown in Column No.3 of Part B. Therefore, the school management should comply Karnataka Fire & Emergency Services Department to provide additional equipment and then intimate to this office within 3 months positively without fail.


Yours faithfully,



CHIEF FIRE OFFICER
Bangalore East
Karnataka State Fire & Emergency Service
BANGALORE - 560 025.

Copy to Regional Fire Officer, Bangalore East range, Bangalore.

Copy with complements: Submitted to the Director General of Police and Director General, Karnataka Fire and Emergency Services, Bangalore.

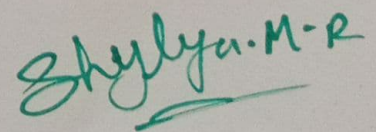

Principal
Sri Chaitanya Techno School
Horamavu